



AUDIO SERVICE

Information

BULLETIN NO.: 05-84

DATE: May 1984


SUBJECT: A-960 Amplifier

PROBLEM: Power won't come on, circuit checks out normal

CAUSE: Burnt out lamp in "Power" switch button, also in "Main Direct" or "Disc" button when switch is activated.

REMEDY: Replace burnt out lamp(s) and modify lamp circuit.

MODIFICATION: Solder a 22 ohm 1/4W resistor in series with a 10 volt 1 watt zener diode to connector pins shown on diagram as RD-1, RD-2, and RD-3.

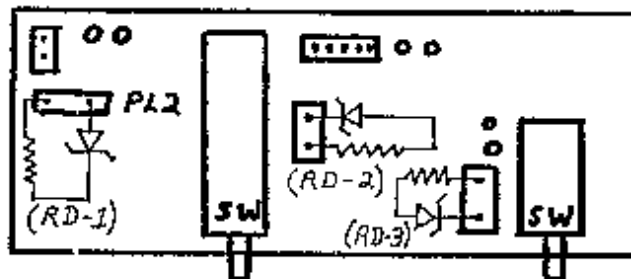

Tone control
cct. board

PARTS: Lamp(s) (10.5V 80ma) part number JB000920 or equivalent.

HV 454220

Resistors (3) 22 ohm 1/4 watt or 1/2 watt *FLAME PHOTO*

DOUG HAS IN TECH ROOM

Zener Diodes (3) 10 volt 1 watt

For units under warranty specify
MODIFICATION KIT: 05-84-A-960. ALSO INCLUDE
WARRANTY CLAIM NUMBER AND DATE OF PURCHASE.

NOTE: ***** Please Destroy Bulletin 05-81 dated July 1981 *****
***** " " " 03-83 dated Nov 1983 *****